Heritage Asset Survey						
Building Name:		Building Reference Number:				
Inglis Bridge		LL5196				
Building Address:		Listing Grade:				
n/a – Structure over the Basingstoke Canal						
		II* Locally Listed +]			
Date Listed: 22 December 2020		Conservation Area: Yes: No: +				
Condition Survey: 1 - 5 1 Very Bad 2 Poor 3 Fair 4 Good 5 Excellent						
Feature		Issue identification				
Boundary Walls or Gates	n/a	Local Building Cracking	n/a			
Outbuildings	n/a	5	n/a			
Abutments	n/a		n/a			
Roof	n/a		n/a			
Chimneys	n/a		n/a			
Flashing	n/a		n/a			
Weathering Detail (Valleys etc.)	n/a	5	n/a			
Walls (masonry/brickwork/render)	n/a		Y – timbers rotting			
Pointing	n/a					
Rainwater Goods	n/a					
Windows	n/a					
Doors and Surroundings	n/a					
Lintels	n/a					
Other Features	2					

Historical Context:

(From research by L.E. (Pablo) Haworth on the Basingstoke Canal Society website, https://www.basingstoke-canal.org.uk/bridges/brfarn.htm, accessed 22 July 2019).

The bridge was designed by Sir Charles Inglis for the use of the infantry in 1915 and to carry a pipe across the canal. It is constructed from long tubes that produce a footbridge of triangular cross-section. The bridges were designed for the military and officially called 'Inglis Portable Military Bridges – Light Type', however often referred to as Inglis Pyramid Bridges, due to the structural formation. This is the only know surviving example of an Inglis Bridge, therefore it is a local and possibly national importance.


Criteria submitted:

C. The building or structure dates between 1914 and 1939 and has a particular

quality, character or local significance.

E. The building or structure is the work of a recognised local architect, builder and /or engineer.

I. The building or structure has special local or national historical associations.

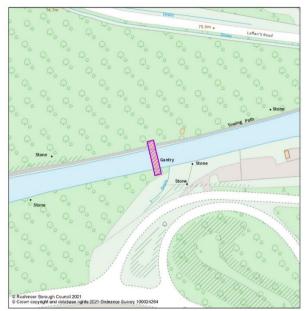

Ownership Type (please tick the appropriate box below):					
Private		Local Authority			
Religious / Charity		Stat Undertakers			
Company		Crown	+		
Photographs					

Date Taken: January 2021

Any Further Comments: A survey of the structures condition was undertaken. The timbers of the bridge are in poor condition with extensive rot evident. The steel components of the structure appeared to be in good condition.

Surveyor: IM	Date: 15/01/21
--------------	----------------